


# Shielded Cable Termination Flexible Cable - Straight Crimp Type End Launch





INCHES (MILLIMETERS)  
CUSTOMER DRAWINGS AVAILABLE UPON REQUEST

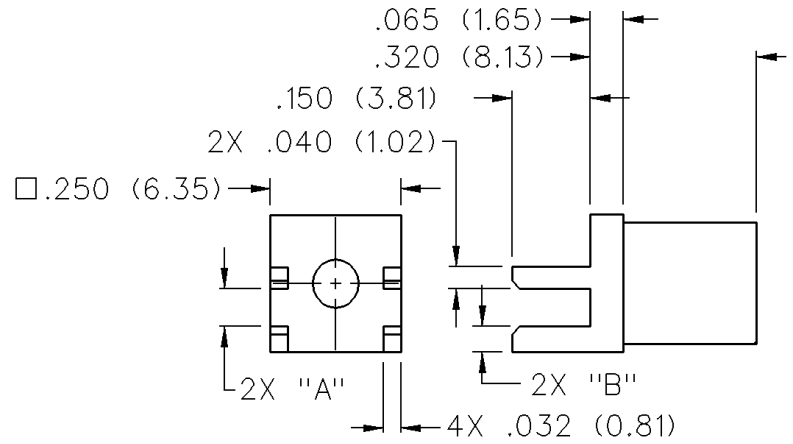

CABLE TYPE	BOARD THICKNESS	GOLD PLATED	"A"	"B"
RG316 DS, 188 DS, 179 DS, 187 DS	0.062 (1.57)	142-0004-801	0.068 (1.73)	0.046 (1.02)

CABLE GROUP	PART NUMBER	CRIMP HEX
RG-316DS, 188DS, 179DS, 187DS	142-0004-801	.128 (3.25)

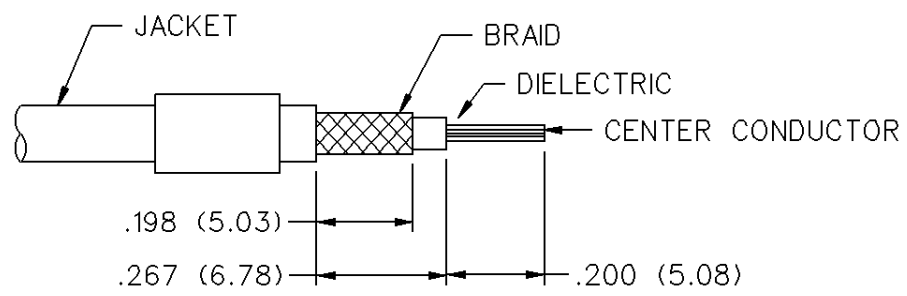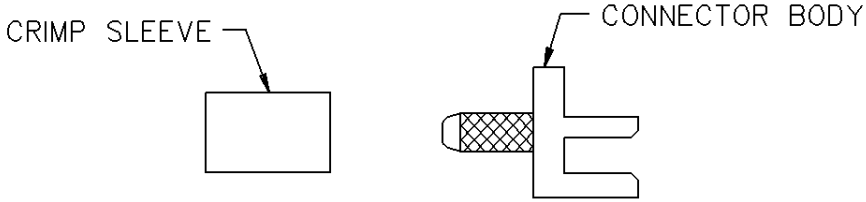

1. Identify connector parts. (2 piece parts)
2. Strip cable to dimensions shown. Do not nick braid or center conductor. A wire stripper of correct size is recommended for this step. Twist stranded center conductor into tight bundle and tin. Slide crimp sleeve onto cable as shown.
3. Flare braid and slide cable into body making certain that the cable insulation is flush with bottom of connector body.
4. Arrange braid uniformly around crimp stem. Slide crimp sleeve over braid and crimp securely using recommended crimp tool.