



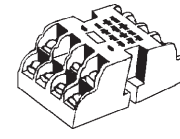
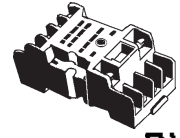
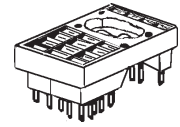
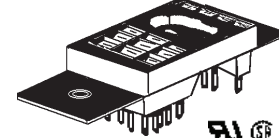
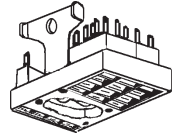
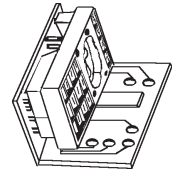
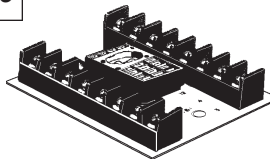

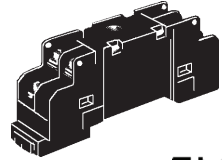
# SOCKETS

## RELAY AND SOCKET USAGE CHART



Relay	Socket	Terminal Type	Hold Down Spring	Socket Fig. Number	NOTES: See page 19 of P&B.
KBP (11pin octal)	27E123	Screw	-	3	-
	27E892	Screw	20C419	4	7,8
	27E006	Solder	20C217	12	13
	27E007	PC	20C217	12	-
	27E023	PC	20C217	12	-
KHA& KH	27E166	Screw	20C297	13	-
	27E894	Screw	20C297	14	7,11
	27E122	Screw	-	1	-
	27E891	Screw	20C419	2	7,11
	27E122	Screw	-	1	-
KRP3-H (8-pin-octal)	27E891	Screw	20C419	2	7,11
KRPA & KRP (8-pin octal)	27E122	Screw	-	1	-
KRPA & KRP (11-pin octal)	27E891	Screw	20C419	2	7,11
KUEP KUGP, KUIP KUMP& KUP (1-3 Poles with .187 QC Terms)	27E123	Screw	-	3	-
	27E892	Screw	20C419	4	7,11
	27E043	Solder	20C228 or 20C254	5	9
	27E046	PC	20C228 or 20C254	5	9
	27E067	QC & Solder	20C228 or 20C254	5	9
	27E088	Blank	20C228 or 20C254	5	9
	27E121	Screw	20C314	6	10
	27E396	QC& Solder	20C254	7	-
	27E400	Solder	20C254	7	-
	27E893	Screw	20C318	8	7,11
KUL (1-3 Poles with .187 QC Term)	27E043	Solder	20C247 or 20C255	5	12
	27E046	PC	20C247 or 20C255	5	12
	27E067	QC & Sloder	20C247 or 20C255	5	12
	27E088	Blank	20C247 or 20C255	5	12
	27E121	Screw	20C314	6	10
	27E396	QC& Solder	20C254	7	-
	27E400	Solder	20C254	7	-
	27E893	Screw	20C318	8	7,11
KUP (4 pole with .110 QC Terms.)	27E415	QC & Solder	20C228 or 20C254	5	9
	27E419	PC	20C228 or 20C254	5	9
	27E867	Screw	20C254	5	6
R10, R10L & R10S (2 pole)	27E125	Solder	20C249	15	2,4,14
	27E701	Solder	20C249	15	2,4,15
	27E162	Solder	20C249	15	2,4,16
	27E128	PC Stag.	20C249 or 20C259	15	2,4,14
	27E446	Solder	20C249	16	1,2,4,14
	27E709	PC Stag.	20C249 or 20C259	15	2,4,15
	27E193	PC Stag.	20C249 or 20C259	15	2,4,14
	27E717	PC Stag.	20C249 or 20C259	15	2,4,15
	27E212	PC Stag.	20C249 or 20C259	15	2,4,16
	27E342	PC in-line	20C249 or 20C259	15	2,4,16
	27E317	Solder/Bkt. Mt.	20C249	17	2,4,14
	27E215	PC Rt. Angle	20C249	18	2,4,5,19
	27E460	Screw	20C249 or 20C259	19	2,4,5,16
	R10,R10L & R10 (4 pole)	27E126	Solder	20C250	15
27E702		Solder	20C250	15	3,4,15
27E163		Solder	20C250	15	3,4,16
27E447		Solder	20C250	16	1,3,4,14
27E710		PC Stag.	20C250 or 20C259	15	3,4,15
27E194		PC Stag.	20C250 or 20C259	15	3,4,17
27E740		PC Stag.	20C250 or 20C259	15	3,4,18
27E213		PC Stag.	20C250 or 20C259	15	3,4,16
27E714		PC Stag.	20C250 or 20C259	15	3,4,20
27E629		PC in-line	20C250 or 20C259	15	3,416
27E152		Solder/Bkt. Mt	20C250	17	3,414
27E461		Screw	20C250 or 20C259	19	3,4,616
R10, R10L (6 pole)		27E127	Solder	20C251	15
	27E164	Solder	20C251	15	4,16
	27E130	PC Stag.	20C251 or 20C259	15	4,14
	27E448	Solder	20C251	16	1,4,14
	27E195	PC Stag.	20C251 or 20C259	15	4,17
	27E271	PC Stag.	20C251 or 20C259	15	4,16
	27E715	PC Stag.	20C251 or 20C259	15	4,20
	27E630	PC in-line	20C251 or 20C259	15	4,16
	27E462	Screw	20C251 or 20C259	19	4,6,16
	27E211	Solder	20C266	15	4,14
R10 (8 pole)	27E254	PC Stag.	20C266 or 20C 259	15	4,14
R10-T1 (8-pin octal)	27E122	Screw	-	1	-
R10-T2 (11 pin octal)	27E891	Screw	20C419	2	7,11
R12 (8 pin octal)	27E123	Screw	-	3	-
RKA/RKS	27E892	Screw	20C419	4	7,11
R12	27E131	Solder	20C251	15	14
RKA/RKS	27E132	PC	20C251 or 20C259	15	14
RKA	27E936	PC	20C418	20	21
RKA	27E937	PC	20C418	20	22
RKS	27E937	PC	20C418	20	23

### SOCKET FIGURES

<p><b>13</b></p>  <p>2.363 x 1.22 x .800h</p>	<p><b>14</b></p>  <p>2.441 x 1.181 x .984</p>
<p><b>15</b></p>  <p>Sizes vary with number of poles Please call for exact information for your application.</p>	<p><b>16</b></p>  <p>Sizes vary with number of poles Please call for exact information for your application.</p>
<p><b>17</b></p>  <p>Sizes vary with number of poles Please call for exact information for your application.</p>	<p><b>18</b></p>  <p>Sizes vary with number of poles Please call for exact information for your application.</p>
<p><b>19</b></p>  <p>2.75" wide x 3592 high and have .187 dia. mtg. holes. Length, mtg. Centers vary.</p>	<p><b>20</b></p>  <p>1.18 x .51 x .39h</p>
<p><b>21</b></p>  <p>2.76 x .63 x 1.06h</p>	