

Sockets & Accessories, R10 Relays

- Sockets for 2 6 pole relays
- Solder, PCB or screw terminal sockets
- **■** Choice of grounding provision on sockets
- **■** Hold down springs
- Plates and brackets permit various mounting options



Approvals UL E59244, CSA LR15734 Technical data of approved types on request

Spring brass, tin plated
Polyester
Phenolic
10A
30mV max. at 10A
1,000Vrms
$10^9\mathrm{meg}\Omega$

Solder and PC terminal sockets

Rugged, molded socket body retains floating terminals of either solder or printed circuit pin configuration. PC terminal sockets are offered with pins in either 0.1" (2.54mm) grid or in-line arrangement.

Grounding provisions
Pre-installed on sockets

Not for use at 5A AC and above.

Grounding Strip: Mounting stud of relay contacts grounding strip. Grounding strip is grounded with screw or rivet through round hole in socket. Grounding Terminal (PC sockets only): Mounting stud of relay contacts ground terminal through square hole in socket.

Ordering Code





Product	Poles	Terminal type	Grounding	Part
Code			provision	number
27E125	2	solder terminals	strip	1393143-8
27E126	4			1393143-9
27E127	6			1-1393143-0
27E162	2		none	1-1393143-6
27E163	4			1-1393143-7
27E164	6			1-1393143-8
27E128	2	PCB terminals,.180"	strip	1-1393143-1
27E129	4	(4.57mm) long,		1-1393143-2
27E130	6	staggered layout		1-1393143-3
27E212	2		none	2-1393143-4
27E213	4			2-1393143-5
27E271	6			3-1393143-1
27E193	2		terminal	2-1393143-1
27E194	4			2-1393143-2
27E636	2	PCB terminals, 210"	strip	5-1393143-0
27E637	4	(5.33mm) long,		5-1393143-1
		staggered layout		
27E342	2	PCB terminals,.180"	none	3-1393143-6
27E629	4	(4.57mm) long,		4-1393143-8
27E630	6	in-line layout		4-1393143-9

All accessories must be ordered separately.

Strip



Terminal



Caution:


Printed circuit sockets are manufactured with "floating" (loose) terminals. This permits them to align with holes in the circuit board and with the relay terminals. During the mounting and soldering of the socket, vertical float should be eliminated and the terminals seated on the board. (This may be accomplished by inserting a dummy relay in the socket.) Failure to eliminate float may cause fracture of the solder joint or separation of the copper conductor from the printed circuit board when a relay is inserted in the socket after soldering.



Sockets & Accessories, R10 Relays (Continued)


Dimensions

Solder and PC terminal sockets

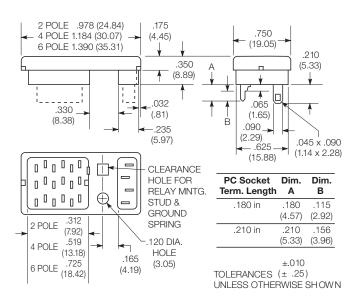

PCB layout


Sockets with staggered PC terminals

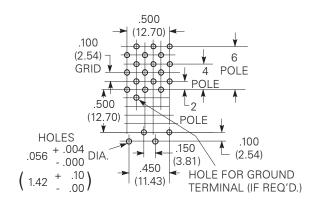


Sockets with inline PC terminals

PCB layout (top view)

Sockets with solder terminals

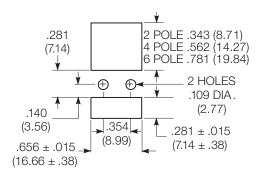

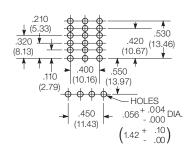




Sockets & Accessories, R10 Relays (Continued)

Ordering Code


Product Code	Poles			Grounding	Part number
		type	type	provision	
27E317	2	solder	bracket	strip	3-1393143-4
27E152	4				1-1393143-5
27E446	2	solder	flange	strip	4-1393143-1
27E447	4				4-1393143-2
27E448	6				4-1393143-3
27E460	2	screw	track/	none	1393837-1
27E461	4		chassis		4-1393143-4
27E462	6				4-1393143-5

All accessories must be ordered separately.

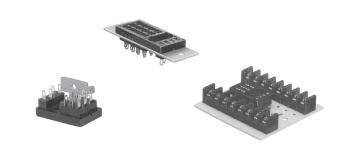


Dimensions

Bracket Mount socket 27E317 and 27E152 Allows solder terminal relay to mount flat on a chassis.

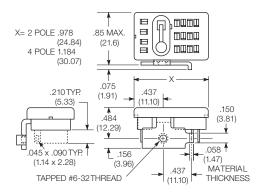


Flange mount socket 27E446, 27E447, 27E448 Solder terminal socket with tip-plated terminals and grounding

Solder terminal socket with tin-plated terminals and grounding strip pre-assembled on .065" (1.65mm) steel mounting plate. Requires only one chassis cutout.

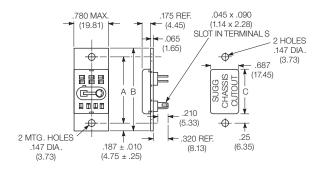


Track mount sockets 27E460, 27E461, 27E462 Provides front wiring, screw terminal connections for R10 family relays. No grounding provision.

2 pole terminal wiring code

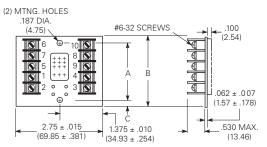


Socket	Poles	Dim A	Dim B	Dim C
27E446	2	1.437 (36.50)	1.822 (46.27)	.937 (23.80)
27E447	4	1.687 (42.85)	2.072 (52.63)	1.125 (28.58)
27E448	6	1.875 (47.63)	2.260 (57.40)	1.343 (34.11)


4 pole terminal wiring code

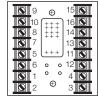

Suggested track mounting

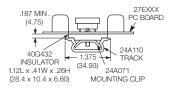

6 pole terminal wiring code

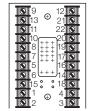

Suggested chassis mounting

